

Permanent Magnet Motor Safety

API RECOMMENDED PRACTICE 11S3
FIRST EDITION, MARCH 2023



American
Petroleum
Institute

Special Notes

API publications necessarily address problems of a general nature. With respect to particular circumstances, local, state, and federal laws and regulations should be reviewed. The use of API publications is voluntary. In some cases, third parties or authorities having jurisdiction may choose to incorporate API standards by reference and may mandate compliance.

Neither API nor any of API's employees, subcontractors, consultants, committees, or other assignees make any warranty or representation, either express or implied, with respect to the accuracy, completeness, or usefulness of the information contained herein, or assume any liability or responsibility for any use, or the results of such use, of any information or process disclosed in this publication. Neither API nor any of API's employees, subcontractors, consultants, or other assignees represent that use of this publication would not infringe upon privately owned rights.

API publications may be used by anyone desiring to do so. Every effort has been made by the Institute to ensure the accuracy and reliability of the data contained in them; however, the Institute makes no representation, warranty, or guarantee in connection with this publication and hereby expressly disclaims any liability or responsibility for loss or damage resulting from its use or for the violation of any authorities having jurisdiction with which this publication may conflict.

API publications are published to facilitate the broad availability of proven, sound engineering and operating practices. These publications are not intended to obviate the need for applying sound engineering judgment regarding when and where these publications should be used. The formulation and publication of API publications is not intended in any way to inhibit anyone from using any other practices.

Information concerning safety and health risks and proper precautions with respect to particular materials and conditions should be obtained from the employer, the manufacturer or supplier of that material, or the material safety data sheet.

Where applicable, authorities having jurisdiction should be consulted.

Work sites and equipment operations may differ. Users are solely responsible for assessing their specific equipment and premises in determining the appropriateness of applying the recommended practice. At all times users should employ sound business, scientific, engineering, and judgment safety when using this recommended practice.

API is not undertaking to meet the duties of employers, manufacturers, or suppliers to warn and properly train and equip their employees, and others exposed, concerning health and safety risks and precautions, nor undertaking their obligations to comply with authorities having jurisdiction.

Any manufacturer marking equipment or materials in conformance with the marking requirements of an API standard is solely responsible for complying with all the applicable requirements of that standard. API does not represent, warrant, or guarantee that such products do in fact conform to the applicable API standard.

All rights reserved. No part of this work may be reproduced, translated, stored in a retrieval system, or transmitted by any means, electronic, mechanical, photocopying, recording, or otherwise, without prior written permission from the publisher. Contact the publisher, API Publishing Services, 200 Massachusetts Avenue, NW, Suite 1100, Washington, DC 20001.

Copyright © 2022 American Petroleum Institute

Foreword

Nothing contained in any API publication is to be construed as granting any right, by implication or otherwise, for the manufacture, sale, or use of any method, apparatus, or product covered by letters patent. Neither should anything contained in the publication be construed as insuring anyone against liability for infringement of letters patent.

The verbal forms used to express the provisions in this document are as follows.

Shall: As used in a standard, “shall” denotes a minimum requirement in order to conform to the standard.

Should: As used in a standard, “should” denotes a recommendation or that which is advised but not required in order to conform to the standard.

May: As used in a standard, “may” denotes a course of action permissible within the limits of a standard.

Can: As used in a standard, “can” denotes a statement of possibility or capability.

This document was produced under API standardization procedures that ensure appropriate notification and participation in the developmental process and is designated as an API standard. Questions concerning the interpretation of the content of this publication or comments and questions concerning the procedures under which this publication was developed should be directed in writing to the Director of Standards, American Petroleum Institute, 200 Massachusetts Avenue, NW, Suite 1100, Washington, DC 20001. Requests for permission to reproduce or translate all or any part of the material published herein should also be addressed to the director.

Generally, API standards are reviewed and revised, reaffirmed, or withdrawn at least every five years. A one-time extension of up to two years may be added to this review cycle. Status of the publication can be ascertained from the API Standards Department, telephone (202) 682-8000. A catalog of API publications and materials is published annually by API, 200 Massachusetts Avenue, NW, Suite 1100, Washington, DC 20001.

Suggested revisions are invited and should be submitted to the Standards Department, API, 200 Massachusetts Avenue, NW, Suite 1100, Washington, DC 20001, standards@api.org.

Contents

1	Scope.....	1
2	Normative References	2
3	Terms, Definitions, Acronyms, and Abbreviations	3
3.1	Terms and Definitions	3
3.2	Acronyms and Abbreviations	12
4	Nature of Risks and Approach to Safety	13
4.1	General	13
4.2	Multiple Sources of Power	13
4.3	Unplanned Motor Rotation	14
4.4	Electrical Protection	15
4.5	Risk Management.....	16
5	Job Safety Planning.....	17
5.1	General	17
5.2	Safety Controls.....	18
5.3	Job-specific Planning	20
5.4	Prevention of Unplanned Motor Rotation.....	20
5.5	Protection of Personnel and Equipment	23
5.6	Continuous Monitoring.....	23
5.7	Working with Electrical Cables and Penetrators	24
5.8	Workspace and Safe Egress	24
5.9	Junction Boxes	24
5.10	Surface Equipment	25
5.11	Isolation Switch	25
6	Equipment Preparation and Handling.....	25
6.1	General	25
6.2	Cable.....	25
6.3	Motor Markings	26
6.4	Handling of Magnetic Devices	26
6.5	Magnet Transport.....	26
6.6	Air Transport	26
6.7	Disposal	26
7	Arrival at Location.....	27
7.1	General	27
7.2	Job Safety Briefing	27
7.3	Arrivals During Work	28
7.4	Unplanned Call-out Troubleshooting.....	29
7.5	Work Plan Execution Activities	29
7.6	Spooler (Run in Hole and Pull out of Hole)	29
7.7	Grounding.....	29
7.8	Access Barriers and Alerting Techniques.....	30
7.9	Surface Equipment	30
8	Installation (Run in Hole).....	30
8.1	General	30
8.2	Run in Hole-specific Job Safety Planning	30
8.3	General Run in Hole Actions	31
8.4	Conventionally Deployed	32
8.5	Cable Deployed	35
8.6	Through Tubing Deployed: Threaded or Coupled Tubing.....	35
8.7	Through Tubing: Coiled Tubing Deployed, External Cable	35
8.8	Through Tubing: Coiled Tubing Deployed, Internal Cable	35
8.9	Docking Station Deployed	35
8.10	Surface Permanent Magnet Motor.....	37

9	Pull out of Hole	38
9.1	General	38
9.2	Pull out of Hole—specific Job Safety Planning	38
9.3	Operator Planning and Notification of Pending Pull	38
9.4	Electrical Damage	38
9.5	Prevention of Rotation	39
9.6	Feedthroughs	39
9.7	Spooler	39
9.8	Retrieval	39
9.9	Intact Electrical System	39
9.10	Damaged Electrical System	40
9.11	Bottom Hole Assembly at Surface	40
9.12	Conventionally Deployed	40
9.13	Completion	40
9.14	Cable Deployed	40
9.15	Through Tubing Deployed: Threaded or Coupled Tubing	41
9.16	Through Tubing: Coiled Tubing Deployed, External Cable	41
9.17	Through Tubing: Coiled Tubing Deployed, Internal Cable	41
9.18	Docking Station Deployed	41
9.19	Surface Permanent Magnet Motor	42
10	Commissioning	42
10.1	General	42
10.2	Recommended Workflow	43
10.3	Electrical Isolation/LOTO Verification	43
10.4	Equipment Setup/Checks	43
10.5	Connections to Vented Junction Box	44
10.6	Startup Preparation	44
10.7	Startup	44
10.8	Handover	44
11	Ongoing Operations and Maintenance	45
11.1	General	45
11.2	Maintenance-specific Job Safety Planning	45
11.3	Access to Surface Electrical Connections	45
11.4	Surface Permanent Magnet Motor	46
12	Well Control or Cable Damage	47
12.1	General	47
12.2	Well Control	47
12.3	Cable Damage at Surface	48
13	Surface Electrical Equipment	48
13.1	General	48
13.2	Drive Selection and Use with Permanent Magnet Motors	49
13.3	Accessing Equipment	50
14	Cable Operations—Spooler, Cutting, Splicing, and Feedthroughs	50
14.1	General	50
14.2	Electrical Power System One-line Diagram	50
14.3	General Recommendations	53
14.4	Spooler Operations	54
14.5	Changing Out Cable Reel	54
14.6	Cable Cutting	54
14.7	Splicing	55
14.8	Electrical Cable Feedthroughs	56
	Annex A (normative) Training and Task Qualification	62
	Annex B (normative) Selection and Use of Electrical Instrumentation	66
	Annex C (normative) Selection and Use of Personal Protective Equipment	72

Annex D (normative) Grounding and Task Qualification	74
Annex E (normative) Signage and Identification	77
Annex F (informative) Types of Permanent Magnet Motor Deployment	81
Annex G (informative) Progressing Cavity Pumps	87
Annex H (informative) Arc Flash Pertaining to Permanent Magnet Motors	89
Annex I (informative) Open and Closed Electrical Submersible Pump Power Cable Ends	92
Annex J (informative) Variable Speed Drives	99
Annex K (informative) Mitigation Techniques	100
Bibliography	105

Figures

1 Comparison of Induction and Permanent Magnet Motors	vii
2 Typical High-voltage Electrical Submersible Pump System	2
3 Operational Flow of Document	3
4 Voltage and Current in Electrical Shock	14
5 Hazardous and Nonhazardous Areas at Wellsite Location	17
6 Possible Locations for LOTO	28
7 Running in Hole Workflow	33
8 Commissioning Workflow	43
9 Sucker Rod Unit Transmission Types	47
10 Typical Surface Electrical Equipment	49
11 Conventional Electrical Submersible Pump: Electrical Power System One-line Diagram	52
12 Cable Terminations in Reel	54
13 Feedthrough Classification	56
14 Surface Pigtail	60
15 Protective Cap Cut-aways	60
16 Feedthrough with Enclosed Terminals	61
C.1 Electrical Personal Protective Equipment Example	72
D.1 Conventional Grounding of Surface Electrical Equipment	74
D.2 Equipotential Bonding Zone at the Spooler	75
E.1 Example Signage Locations for Permanent and Temporary Equipment	77
E.2 Other Locations for Signage	78
E.3 Example of Labels That May Be Used for Permanent Magnet Motor Applications	80
F.1 Representative Conventional Electrical Submersible Pump Deployment	82
F.2 Cable Unit Deployed Electrical Submersible Pump after Completion	83
F.3 Coiled Tubing Deployment, Internal Cable	84
I.1 Permanent Magnet Motor Electromotive Force Voltage Measured When Shaft Rotating	92
I.2 Permanent Magnet Motor Electromotive Force Voltage Generated During Backspin	93
I.3 Permanent Magnet Motor Short-circuit Performance Curves	94
I.4 Voltage and Current with Two Phases Shorted	95
I.5 Normal Operation Voltages Along Cable	96
I.6 Hazardous Situations—Voltages Along Cable	98
K.1 Reel-mounted Device for Permanent Magnet Motor Cable	100
K.2 Shorting and Grounding Components	101
K.3 Spooler Continuous Grounding System	101
K.4 Grounding and Isolation Switch for Downhole Permanent Magnet Motor-driven Progressing Cavity Pump Systems	102
K.5 Continuous Monitoring Shorting and Grounding for Spooler and Splicing	102
K.6 Personal Protective Equipment Usage and Volt Stick at Shunt	103
K.7 Well Control Tools	104

Tables

1 Deployment Types	1
A.1 Approximate Comparison of Terms	65
G.1 Downhole-driven Progressing Cavity Pump Methods	87

Introduction

In electrical submersible pump (ESP) systems, two motor technologies provide power to the pump: the AC induction motor (IM) and the permanent magnet motor (PMM). The IM has been the industry standard since 1916. It evolved over time with many improvements and is a mature technology in 2021. PMM, a younger technology originating in the 1990s, also evolved in the early 2000s and has gained global commercial acceptance since 2010. PMM requires more precautions due to the construction and physics of the motor and how it generates voltage. Figure 1 provides a brief comparison of the two motor technologies.

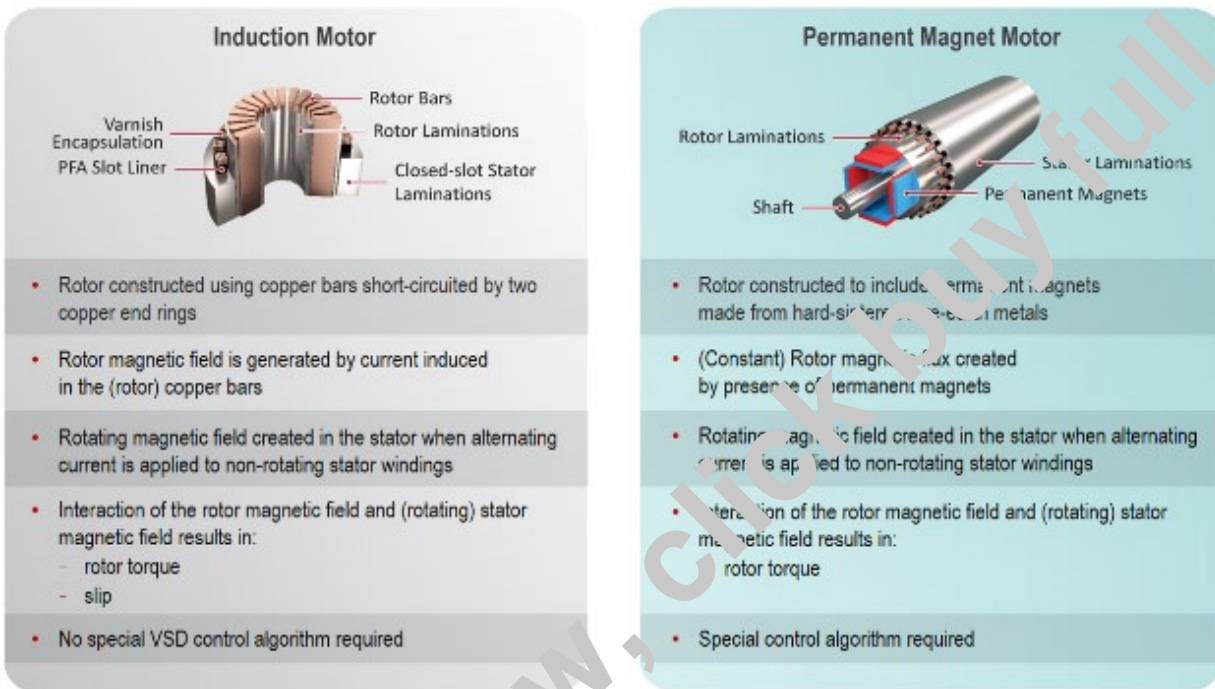


Figure 1—Comparison of Induction and Permanent Magnet Motors

In both IM and PMM, the ability to perform work arises from the torque produced by a rotating shaft resulting from the attraction of rotating electromagnetic poles in the stator to corresponding opposite magnetic poles in the rotating rotor. It is the presence of three-phase currents flowing through the stator windings, which creates the rotating stator magnetic poles, although the physical stator itself is stationary. The poles on the rotor are created in fundamentally different ways.

- In the case of the IM, the stator magnetic field rotating relative to the rotor induces an opposing current in the rotor which in effect acts like secondary windings, much like a transformer. This rotor current creates electromagnetic poles on the rotor. This current consumes a significant amount of energy and is a major source of the IM efficiency losses.
- Although the PMM has many of the same contributors to loss of efficiency (such as windage and stator core losses), the rotors do not require additional magnetization as they are already magnetized per the specifics of their design and the use of permanent magnets. Due to this elimination of a large source of waste power consumption, the PMM can run much more efficiently than the IM.

One of the implications of this is that the PMM will typically have a much lower idle current than the IM. Whereas an IM may have an idle current of around 35–45 % of the nameplate rating when operating at nameplate voltage, the PMM may have only around 5–10 % of the nameplate current. Exact details of PMM design will vary between suppliers.

In both IM and PMM, the poles on the rotating rotor cause an internal voltage to be generated in the stator winding, known as the electromotive force (EMF). In an IM, if the shaft rotates while the motor is disconnected from any external power source, only the residual magnetic field in the steel laminations is available to generate EMF. In most applications, this residual magnetism will be negligible such that there is no hazardous level of EMF generated, although it is known for back-spinning IMs to generate hazardous voltage. However, EMF will be generated in a PMM any time that the shaft is rotated as the rotor poles, which are magnetically strong, are always present. This EMF will be proportional to the shaft rotational speed regardless of the direction of rotation.

In a conventional well application (oil, gas, water, utility), well fluids moving up the casing-tubing annulus (kick or annular injection) or down the tubing (draining or injection through the production tubing) and then through the pump can cause the shaft to rotate, and thus the PMM to generate EMF. The faster the rotation, the higher the generated voltage that can lead to various electrical hazards, shock, burns, or arc flash.

Despite the EMF associated with PMM technology, their benefits in energy and CO₂ savings and higher power density cannot be ignored. With proper organizational capability and operational excellence, the technology can be used safely on a routine basis. The purpose of this document is to provide recommendations and information to assist with this task.

Permanent Magnet Motor Safety

1 Scope

This document serves to emphasize safety aspects and recommended practices concerning the handling, installation, trouble shooting, operation, and pulling of permanent magnet motors (PMMs) used in subsurface and surface artificial lift pumping systems.

This document does not replace any other specific safety documentation; national and/or local electrical regulations take precedence.

Subsurface systems entail the motor located downhole with the pump. Centrifugal pumps are historically called an electrical submersible pump (ESP). A progressing cavity pump (PCP) mated with a downhole motor with or without a gear reduction unit is typically called an electrical submersible PCP.

For this recommended practice, [Figure 2](#) will be used as reference for a high-voltage conventional ESP system. The submersible system may have a pump that is centrifugal (default), co-helical, axial, progressing cavity, gear, vane, or other type of rotational pump. The motor will be of rotational nature to drive the aforementioned pumps and of permanent magnet design.

There are many types of equipment configurations available for PMM operation. Configurations included in this document are listed in [Table 1](#).

Table 1—Deployment Types

Deployment	R.O.H	POOH	Informative
Conventional	8.4	9.12	F.2
Cable unit	8.5	9.13	F.3
Through tubing: threaded or coupled tubing	8.6	9.15	F.4
Through tubing: coiled tubing with external cable	8.7	9.16	F.5
Through tubing: coiled tubing with internal cable	8.8	9.17	F.6
Docking station	8.9	9.18	F.7
Surface PMM	8.10	9.19	F.8
Downhole driven PCPs			Annex G

Each of these system configurations will have various considerations that shall be made to ensure personnel safety. Some are common to all PMM operations, whereas others will be unique to the given configuration.

- Surface pump unit deployments have limited exposure to electrical hazards because the motor is at surface and the shaft or linkage to the pump system can be locked.
- Some deployments install the pump after the motor, and so unplanned motor rotation does not occur when tripping the motor.

In the case of linear submersible pumps, the pump is reciprocating (vertical motion) and is driven by a linear PMM comprising an armature and permanent magnet translator. The armature is the equivalent to the stator, and the translator is the equivalent to the rotor of a conventional ESP. Downhole linear PMM systems are not expressly included in this document as the force required from the fluid to lift the motor and pump is unlikely to result in motor voltage. However, the supplier should be consulted and the principles in this document applied.